
Instructions of Remote Display Meter

GP-3000



1. Technical parameters

Power supply : DC4-20mA signal source , voltage drop <3.5V.

Temperature drift :25PPM


Display range: -1999 ~ 9999

Accuracy: $\pm (0.2\%FS+1 \text{ digit})$

Working temperature: -20 ~70°C

Humidity: $\leq 85\%RH$

2. Dimension

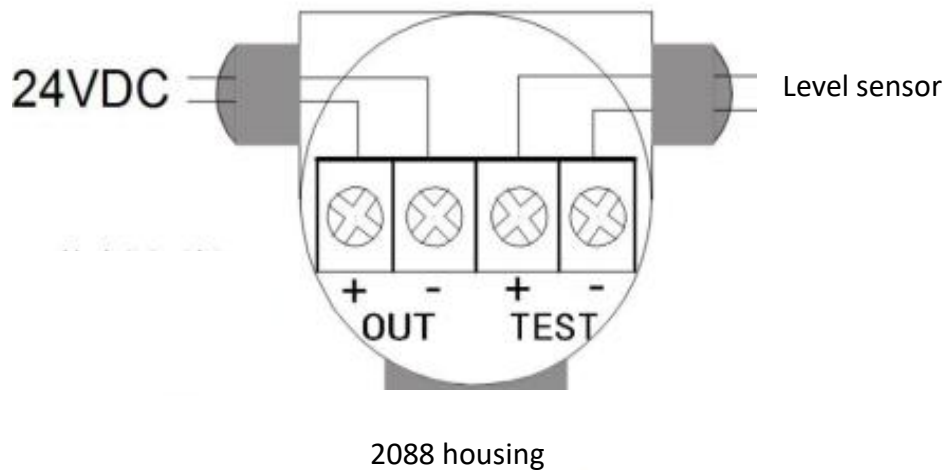

Wiring instructions:

- Out +** connect to power supply +
- Out -** connect to power supply -
- Test +** connect to level sensor +
- Test -** connect to level sensor -

3. Setting menus

